

Subject: SQUEAKING NOISE FROM BRAKE PEDAL	Bulletin No: 04-005/06
	Last Issued: 06/29/2006

APPLICABLE MODEL(S)/VINS

2003 - 2005 Mazda6

DESCRIPTION

The brake pedal makes a squeaking noise while depressing or releasing the pedal. The noise may be due to brake fluid deterioration causing the seal cup to squeak when sliding in the cylinder body.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace brake fluid with Genuine Mazda DOT 3 Brake Fluid according to the Workshop Manual (section 04-11 AIR BLEEDING).
3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Notes
0000-77-130E-10	Genuine Mazda DOT 3 Brake Fluid	Order through Mazda Chemicals Program

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	35
Damage Code	9E
Part Number Main Cause	GK2A-43-300C (M/T) GK2E-43-300A (A/T)
Quantity	0
Operation Number / Labor Hours:	XXB309RX / 0.8 Hrs.